

Market Release Note

MRN-TS1016-004

Product number: TS1016 & TS1016B

Product description: Challenger10 Control Panel - Firmware Upgrade

Product version: V10-03.4479

Affected parts: TS1016 & TS1016B

Release date: 27 August 2014

New features

- **Decrement test days during TZ.** When using automated input testing you can assign a time zone in order to specify which days the system uses to check whether inputs have been tested. This stops inputs false reporting test failures on weekends or when businesses are not open.
- **Reset input test days.** After programming automated input testing you can reset the input timer before handing the system over.

Resolved issues:

- If arming was attempted with an unsealed input and a user category timer running, then arming would fail and the user category would be cancelled.
- Floor groups were not working when assigned to a user.
- Could not arm the area if two user categories were running on the same area.

Known Issues:

- Comm path format Securitel STU, sub-format None, sends system alarms when system alarms report is disabled.
- Report fail message state is cleared when path queue is cleared.
- A dialler path could have an incorrect number of retries.
- Comm path priorities functionality is not yet supported.
- Only two levels of backup path are supported in addition to the primary path (three paths in total).
- We do not recommend using one type of path format to backup a different type of path format (for example, using a CID Dialler path as a backup for Management Software path).
- DVR time and date synchronisation is not supported in this release.
- On a wireless DGP, input numbers displayed on an LCD RAS are incorrect for any DGP address higher than DGP 1. This issue affects only the display of input numbers via LCD RAS when programming a WDGP. The reporting of WDGP inputs to the Challenger10 panel is not affected.

Known issues cont...

- WDPG model CA1230 at DGP address 32 will not respond properly to polling after the Challenger10 is power cycled. DGP addresses 1 to 31 are not affected.
- The Challenger10 panel cannot communicate in polled mode via TCP/IP to management software.

Documentation

Marketing Collateral	Challenger10 datasheet
Challenger10 Manuals	Users Manual
	Installation and Quick Programming Manual
	Programming Manual *
	Administrators Manual
Downloads	Firmware version V10-03.4479

*password protected log in to Interlogix Support Portal required